

Manhole Inspection Summary

Manhole # S13OO1005MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **13001** Node: **005** Status: **Found**

Insp Date: **11/29/06 9:50 AM**

Incomplete Comments

Crew: **CH, HDP**
Inspector: **Hale, C**
Firm: **RKK**

Location Address: **2716 WOODLAND AVE**

Cross Street: **POE AVE**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **7** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S13OO1005MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Corroded steps. Bench debris.

Inside of the I4 pipe



Fractured and broken pipe.

Defect



Frame leaks. Frame offset. Adjustment infiltration.


Manhole Inspection Summary

Manhole # S13OO1005MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

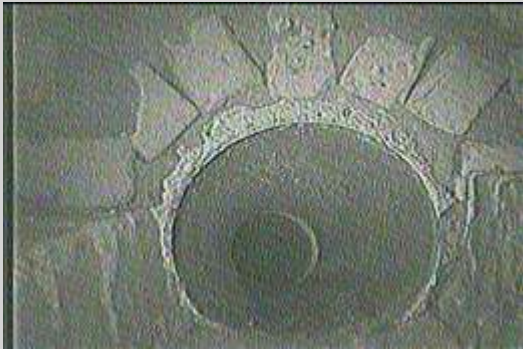

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.23** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 4 O'Clock



Barrel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **2.90** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S13OO1005MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Drop In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **11.72** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.)

Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Broken**

Drop: **Outside** Rod and Bar

Angled: **Yes**

Reading: **12.85** (ft.)

Inv Depth: **13.85** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection